TECHNICAL INFORMATION WECHO.





SUBJECT: Control cable assembly and Handle grip on

ECHO PB-760LN, PB-770 and shindaiwa EB770

Number: Y2017-627(1/2) Issued: Jul. 31, 2017 Revised: Feb. 28, 2019

To prevent contact failure of stop switch contact point by the dust invasion, changed stop switch to the switch with automatic contact point cleaning.

To prevent accumulation of static electricity on the unit, changed handle grip rubber to conductive elastomer and added discharge clip on switch lead

and added discharge clip on switch lead.			
PB-760LN(37)	Serial Number 37003447* to 37003451	No production	Serial Number 37003452 and after
PB-770(30)	Serial Number 30001635* to 370001784	No production	Serial Number 30001785 and after
PB-770(37)	Serial Number 37047187* to 37050754	Serial Number 37050755 to 37051587	Serial Number 37051588 and after
EB770(37)	Serial Number 37001611 and before	Serial Number 37001612 to 37001711	Serial Number 37001712 and after
Handle grip assembly	Ignition switch Not supplied separately Handle grip (left) P021-051881 : PB-760LN, PB-770 P021-051940** : EB770	Handle (right) Control cable assembly Not supplied : PB-760LN, PB-770 P021-051941** : EB770	P021-05 <u>2240</u> : PB-760LN, PB-770 P021-05194 <u>2</u> **: EB770
Control cable assembly	V043-0011 <u>1</u> 0	V043-001140 Changed shape View : A	V043-001170 Soldering Crip for terminal View : A

(Continued)

H28J H28J H28J H28J 090391 --- --- H29E H29E 090910 H29F H29F H29F H29F 091342




^{*} Refer to Technical Information No.Y2015-591 and No.Y2016-611 before this serial number.


^{**}Handle grip assembly P021-051940, P021-051941 and P021-051942 does not include control cable assembly.


TECHNICAL INFORMATION Number: Y2017-627(2/2)




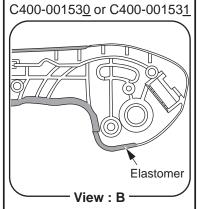

Handle grip (right)

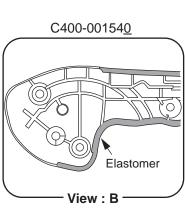

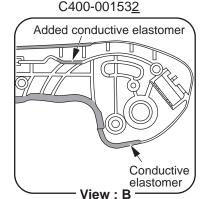

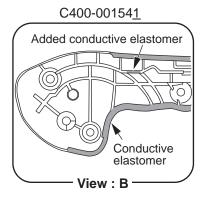

Handle grip assembly P021-05 $\underline{1881}$ can be replaced with P021-05 $\underline{2240}$.

Handle grip (left) C400-001530 and C400-001531 can be replaced with C400-001532.


Handle grip (right) C400-001540 can be replaced with C400-001541.

Control cable assembly V043-001110 and V043-001140 can be replaced with V043-001170.

Clip on control cable assembly V043-001170 installation



Install clip on control cable assembly V043-001170 to the rib made of conductive elastomer.

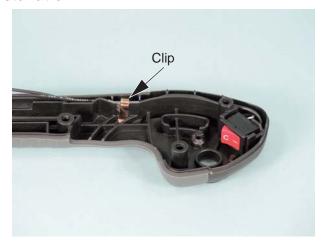

After the installation