
TECHNICAL INFORMATION *((ECHD.)* shindaiwa"

SUBJECT: Carburetor on ECHO CS-4510ES and shindaiwa 451s

Number: Y2019-675(1/2) Issued: Nov. 29, 2019

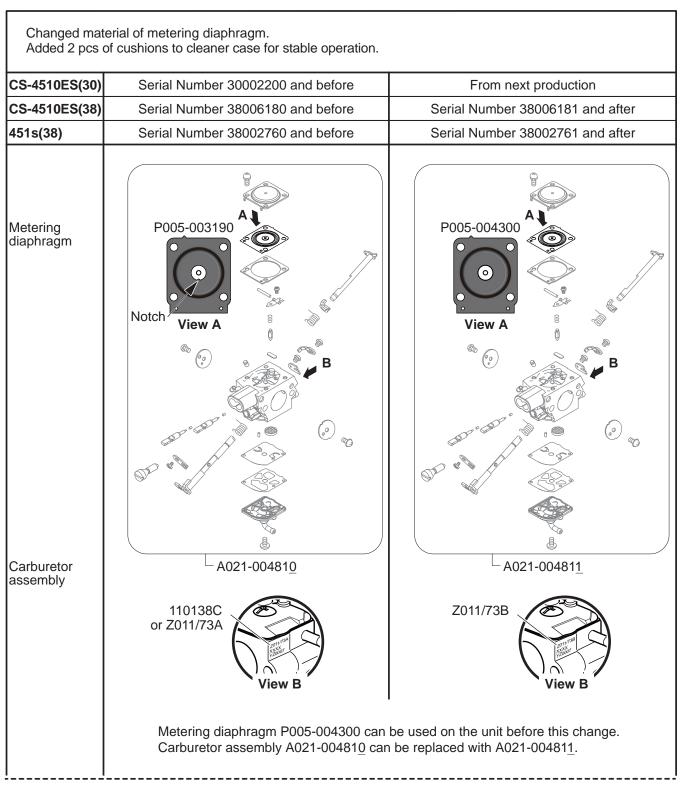


NOTE: Carburetor adjustment procedures are the same.

(Continued)




120186 R1G 120954 R1K


TECHNICAL INFORMATION Number: Y2019-675(2/2)

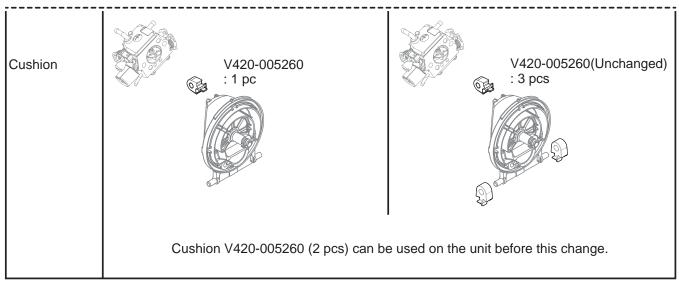

Adding 2 pcs of cushions on cleaner case

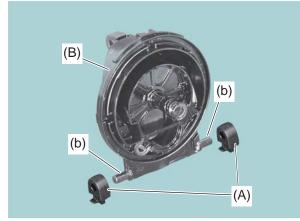

1. Pass 2 cushions V420-005260 (A) through 2 ribs (b) of cleaner case (B).

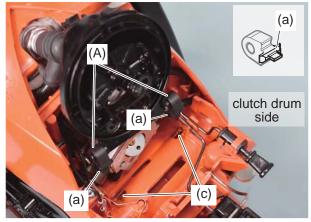


2. Install rib (a) of each cushion (A) in engine cover hole (c).

NOTE: At first, install rib (a) in engine cover hole (c) from clutch drum side to assemble easily.



3. Use flat head screwdriver (D) when it is difficult to install rib (a) of each cushion.

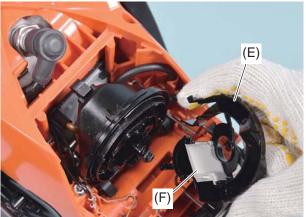

4. Assemble big air duct (E) with small air duct (F). Then tighten 2 torx bolts.