

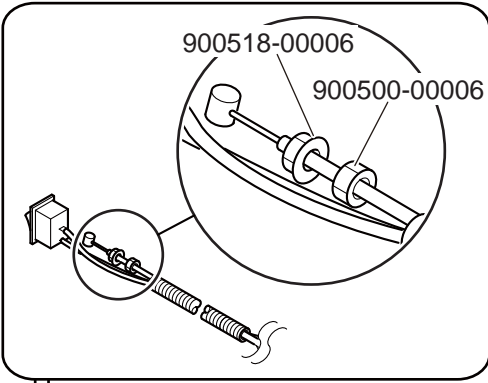
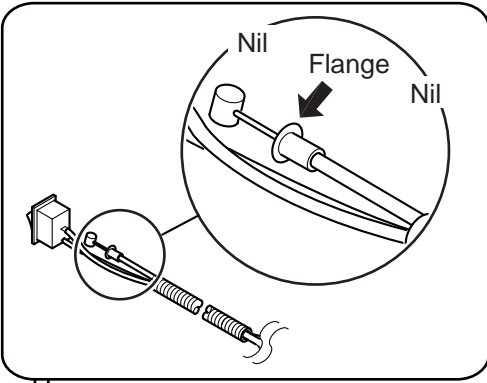
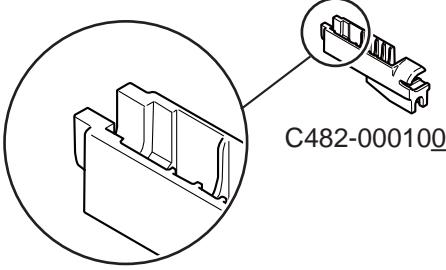
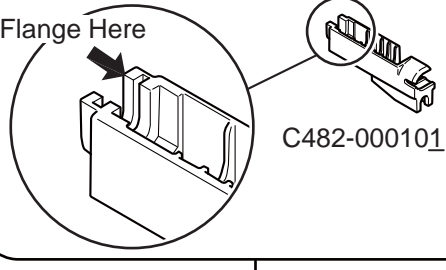
# TECHNICAL INFORMATION



**SUBJECT:** Control cable assembly and Cable connector on **ECHO PB-580, PB-760LN and PB-770**

**Number:** Y2016-611  
**Issued:** Nov. 30, 2016  
**Revised:** May 29, 2020

To make assembling control cable assembly in cable connector easily, control cable assembly and cable connector are changed.

	Serial Number 37004003 and before	Serial Number 37004004 and after
<b>PB-580(37)</b>	Serial Number 37003226* to 37003446	Serial Number 37003447 and after
<b>PB-760LN(37)</b>	Serial Number 30001634 and before	Serial Number 30001635 and after
<b>PB-770(37)</b>	Serial Number 37041470* to 37047186	Serial Number 37047187 and after
Flange nut Nut		
Control cable assembly	PB-580: V043-001 <u>060</u>	PB-580: V043-001 <u>120</u> , V043-001 <u>180</u> , V043-001 <u>190</u> or V043-001 <u>191</u>
Control cable assembly	PB-760LN & PB-770: V043-001 <u>070</u>	PB-760LN & PB-770: V043-001 <u>110</u> , V043-001 <u>140</u> , V043-001 <u>170</u> or V043-001 <u>171</u>
Cable connector	 <p>C482-000100</p>	 <p>C482-000101</p>
Control cable KIT	Nil Nil	PB-580: P200-000510 PB-760LN & PB-770: P200-001160
<p>Control cable assembly for PB-580, V043-001<u>060</u> can be replaced with control cable KIT P200-000510. The control cable KIT includes new control cable assembly V043-001<u>120</u> and new cable connector C482-00010<u>1</u>.</p> <p>Control cable assembly for PB-760LN and PB-770, V043-001<u>070</u> can be replaced with control cable KIT P200-001160. The control cable KIT includes new control cable assembly V043-001<u>171</u> and new cable connector C482-00010<u>1</u>.</p> <p>Cable connector C482-000100 can be replaced with C482-00010<u>1</u>. The new cable connector C482-00010<u>1</u> has been already installed on some units before these serial numbers.</p>		

\* Refer to Technical Information No.Y2015-591 before this serial number.