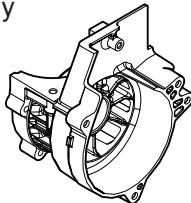
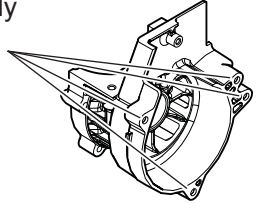

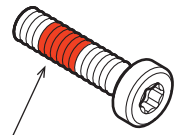


# TECHNICAL INFORMATION

**SUBJECT:** Bolt and crankcase on ECHO PB-8010

**Number:** Y2020-695  
**Issued:** Oct. 30, 2020  
**Revised:** Nov. 30, 2020

Changed bolts for holding starter more securely.  
 Changed starter side crankcase due to changing the bolts.

PB-8010	Serial Number 38010000 and before	Serial Number 38010001 and after
A	Nil	P100-006311
B	P100-006310	Nil
C	Not supplied separately 	Not supplied separately Added tapping 
D	V805-00010 (Tapping screw 5 x 20 mm)  Torque limits; 5.0 - 6.5 N·m	V253-000990 (Metric thread bolt 5 x 20 mm)  Torque limits; 4.5 - 6.5 N·m Pre-coated thread locking sealant*
	Crankcase SET P100-006310 can be replaced with P100-006311. The bolt before change V805-00010 and after change V253-000990 are not interchangeable independently.	

\* If the coat is peeled off when reusing the bolt, replace new one or apply thread locking sealant ThreeBond #1324N or equivalent.